


Instruction Manual

HI 98710 - HI 98810 HI 98740 - HI 98840 Portable Microprocessor Printing and Logging Thermometers

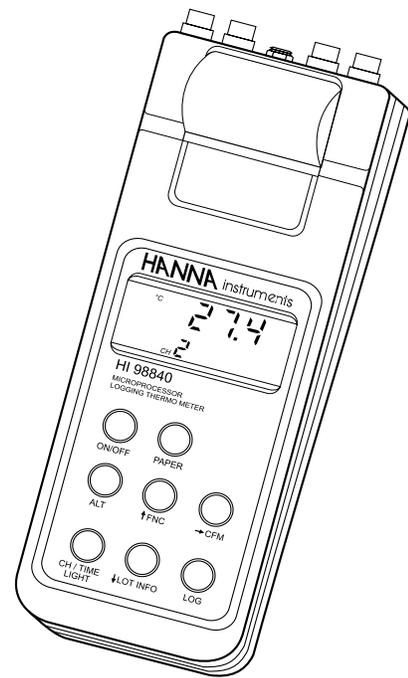

 **HANNA**
instruments
<http://www.hannainst.com>

CE
These Instruments are in
Compliance with the CE
Directives

Dear Customer,

Thank you for choosing a Hanna Instruments Product.

Please read this instruction manual carefully before using the instrument.

This manual will provide you with all the necessary information for the correct use of the instrument, as well as a precise idea of its versatility in a wide range of applications.

These instruments are in compliance with **CE** directives EN 50081-1 and EN 50082-1.

TABLE OF CONTENTS

PRELIMINARY EXAMINATION	3
GENERAL DESCRIPTION	3
FUNCTIONAL DESCRIPTION	5
SPECIFICATIONS	6
INITIAL PREPARATION	7
SETUP MODE	8
TAKING TEMPERATURE MEASUREMENTS	14
TEMPERATURE CALIBRATION PROCEDURE	15
HI98810 / HI98840 PRINTING / LOGGING FUNCTIONS	17
HI98710 / HI98740 PRINTING FUNCTIONS	20
GOOD LABORATORY PRACTICE (GLP)	22
OTHER FEATURES	22
DATA TRANSFER TO PC	23
MEMORY ORGANIZATION	24
PRINTER MAINTENANCE	25
FAULT CONDITIONS	25
BATTERY REPLACEMENT	26
TEST PLUGS	27
TEMPERATURE PROBES	27
UN-HOUSED NTC SENSORS	29
ACCESSORIES	30
WARRANTY	31
CE DECLARATION OF CONFORMITY	31

All rights are reserved. Reproduction in whole or in part is prohibited without the written consent of the copyright owner, Hanna Instruments Inc., 584 Park East Drive, Woonsocket, Rhode Island, 02895, USA.



PRELIMINARY EXAMINATION

Remove the instrument from the packing material and examine it carefully to make sure that no damage has occurred during shipping. If there is any damage, notify your Dealer.

Each thermometer is supplied complete with:

- HI762BL Temperature Probe (one channel version only)
- AA size Alkaline Batteries (4 pcs)
- Instruction Manual
- Paper rolls (5 pcs)
- Rugged Carrying Case.

Note: Save all packing material until you are sure that the instrument functions correctly. All defective items must be returned in their original packaging together with the supplied accessories.

GENERAL DESCRIPTION

The Hanna Instruments portable NTC thermometers with built-in printers are microprocessor-based and enable you to accurately measure temperature and record data.

The instruments housing is made of rugged and lightweight material making it truly portable.

The meters come equipped with an easy-to-read LCD with backlight feature for comfortable reading even in dark environments.

A user friendly interface provides clear messages regarding errors, functions and more.

The GLP features provide a guarantee of data consistency.

Measurements can be performed with lab-grade precision in the field as well as in the laboratory.

An alarm time-out is available to alert the user if too much time has elapsed since the last calibration and that re-calibration may be required.

The meters provide a controlled access to calibration and GLP settings through a password protection method.

The Battery Error Preventing System (BEPS) recognizes batteries levels as they become weaker.

To prolong battery life, the backlight and printing features are disabled when the batteries are getting low; "LOBAT" indication is displayed on LCD to warn the user of this condition. However, the meter continues to measure correctly even when the low battery indication is displayed. The meter automatically switches itself off when the batteries are too weak to support proper function.

The meters are equipped with an internal lithium battery that powers the clock circuit even in the absence of power supplies.


For long term field and lab applications, these meters can be connected to a 12VDC adapter.

HI98810 and **HI98840** have the capability to store the measurements in memory at a user selectable interval from 1 to 180 minutes. This information can be retrieved at a later time and also printed.

HI98810 and **HI98840** also allow the transfer of stored data to a computer via the HI9200 infrared transmitter connected to the computer RS232 port.

Each meter can also be uniquely identified by the user by assigning an ID code.

FUNCTIONAL DESCRIPTION

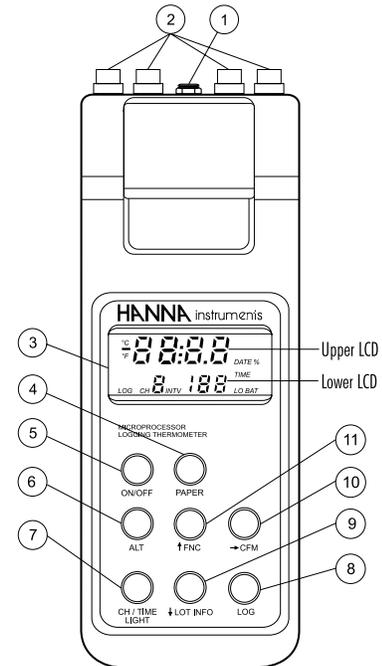

- 1) Power adapter plug
- 2) Temperature Probe Connectors (1 or 4 according to model)
- 3) LCD Display
- 4) PAPER key, to move the paper up
- 5) ON/OFF key, to turn the meter on or off
- 6) ALT key, to alternate key function
- 7) CH/TIME key (HI98740 and HI98840 only) to select input channels, to view date and time, and to enable backlight (with ALT)
TEMP/TIME key (HI 98710, HI 98810 only)
to select temperature reading, to view date and time, and to enable backlight (with ALT)
- 8) **LOG** key, to store and/or print measurements
- 9) ↓LOT INFO key (HI 98810 and HI 98840 only)
to move down or view logging information (with ALT)
↓ key (HI 98710 and HI 98740 only) to move down
- 10) →CFM key, to move right or confirm values (with ALT)
- 11) ↑FNC key, to move up or select function codes (with ALT)

SPECIFICATIONS

Range	-50.0 to 150.0 °C ; -55.0 to 300.0 °F
Resolution	0.1 °C (-30 °C to +130 °C); 0.2 °C outside 0.1 °F (-18 °F to 225 °F); 0.2 °F (225°F to 260 °F); 0.3 °F outside
Accuracy (@20°C/68°F)	±0.4 °C (-20 °C to +120°C); ±0.7 °C outside ±0.8 °F (-4 to +248 °F); ±1.3 °F outside for one year (excluding probe error)
Typical EMC Dev.	±0.4 °C; ±0.8 °F
Channels	HI98710/HI98810: 1 channel HI98740/HI98840: 4 channels
Probe	HI 762 series
Printer	Low power impact type-belt, 14 characters per line; 38 mm plain paper (HI 710034)
Printing/Logging Interval	1, 2, 5, 10, 15, 30, 60, 120 and 180 minutes
Auto shut-off	Selectable at 5, 10, 15, 30, 45 or 60 minutes
Power supply	4x1.5V AA alkaline type/350 hours typical life (with 2700mA/h batteries, without printing and backlight). 12 VDC adapter (HI710005 or HI710006)
Environment	0 to 50°C (32 to 122°F); 0-95% RH non-condensing
Dimensions	220 x 82 x 66 mm (8.7 x 3.2 x 2.6")
Weight	500 g (18 oz)

INITIAL PREPARATION

Each meter is supplied complete with batteries. Remove the back cover, unwrap the batteries and install them while paying attention to the polarity. Alternatively, connect the HI 710005 or HI 710006 voltage adapter to the power adapter plug.

To prepare the instrument for use, choose the most appropriate temperature probe(s) for your application (see accessories) and connect it (them) to the connector(s) located on the top of the instrument.

All the probes have been precalibrated at the factory and no calibration is needed.

With the meter facing you, channel #1 is the first connector on the top left hand side.

To switch the meter on, press the ON/OFF key.

The batteries charge status or "LINE" message (if external power adapter is connected) will be displayed on the LCD for a few seconds.



The meter is now ready to operate.

To maximize battery life, the meter is automatically switched off after a user selectable period of non-use (this feature is enabled and set to 5 minutes by default; it can be disabled or changed through setup code 40). If in logging mode, after the period of non-use, the meter will continue to monitor the temperature periodically at the end of every logging interval. Only the "LOG" indication will be visible on LCD. While storing data in memory, during the sleep mode, the reading will appear briefly on the LCD.

 
To reactivate the display press the ON/OFF key.

Note: When the use of an alternate function (FNC, CFM and LOT INFO) is requested, press and hold the ALT key first and then the second listed key.

SETUP MODE

Setup can be used to view data regarding instrument status (e.g. battery charge) or GLP data (e.g. calibration date) or to view or print the logged data. It also allows the user to change the meter parameters (e.g. time) and to gain access to stored data.

- To enter this mode ensure the meter is not logging and then press the ALT and FNC keys.




- The scrolling message "Insert the function code or press "ALT" - "FNC" to escape" in the upper LCD and the indication "F 00" with the first digit blinking in the lower LCD will be displayed.




- Enter the first digit of the code of the parameter you want to set using the \uparrow or \downarrow key and pass to the next digit with \rightarrow . The second digit will start blinking.



 
- Enter the second digit using the \uparrow or \downarrow key.



 - Press ALT and CFM to confirm the code.



 - If the entered code doesn't exist the "Err" message will be displayed for a few seconds and then the message "Insert the function code or press ALT - FNC to escape" will recommence scrolling in the upper LCD.




PASSWORD PROTECTION

Setting of the GLP parameters (calibration alarm time-out, instrument ID code, time and date) can be password protected. If password is set to a value different from 0000 (factory setting), the user will be asked to enter the password.

- Select the desired GLP parameter code.
- Enter the password by the arrow keys.



 - Press the ALT and CFM keys to confirm.



- If password is wrong the meter will return to the function selection mode without any warning message.
- If password is correct, the meter provides access to the parameter.

PARAMETERS SETTING

- Once the parameter code has been entered, the appropriate message will scroll across the LCD for a few seconds.
- The current value of the selected parameter on the upper LCD and the parameter code on the lower LCD will be displayed. The first digit will blink if the parameter can assume continuous values. All the digits will blink if the parameter can assume only a fixed set of values.
- Enter the new value using the arrow keys.
- Press ALT and CFM to confirm the value.

The following table lists the setup codes along with the description of the specific setup items, their valid values and the factory settings (default):

Code	Valid values	Default
00 Lot data printing/scrolling ¹	00 ÷ 16	00
01 Logging interval	1,2,5,10,15,30,60,120,180	1
02 Print lots data summary ¹		
03 Printer enable ¹	On(enabled); Off(disabled)	On
04 Reset sample number ²		
05 Log on demand delete ¹		

Code	Valid values	Default
06 Timed data delete ¹		
10 Show GLP data		
11 Calibration alarm time-out	On(enabled); Off(disabled)	On
20 Instrument ID code	0000 ÷ 9999	0000
30 Current time ³	hh:mm	00:00
31 Current day ³	dd	01
32 Current month ³	MM	01
33 Current year ³	YYYY	1998
40 Auto-Off/Power down time-out	Off,5,10,15,30,45,60	5
41 Battery level test		
50 RS232 baud rate ¹	1200, 2400, 4800	4800
60 Firmware version		
70 Celsius/Fahrenheit selection	°C ; °F	°C
99 Password ⁴	0000 ÷ 9999	0000

Note: If a wrong code is entered the "Err" message is displayed on LCD for a few seconds.

¹ In HI 98810 and HI 98840 only.

² In HI 98710 and HI 98740 only.

³ The meter automatically checks for entered time/date accuracy as follows:
0≤hh≤23; 0≤mm≤59; 01≤dd≤28/29/30/31; 1≤MM≤12; 1998≤YYYY≤2097.

⁴ To change the password, the correct code must be entered first. If the password has been forgotten, the password protected features are no longer accessible; in this case contact your nearest Hanna Service Center.

SETUP MESSAGES LIST

cod. 00: Lot data Printing
 cod. 01: Log Interval
 cod. 02: Lot table Printing
 cod. 03: Printer enable
 cod. 04: Press "ALT CFM" to reset the sample number or "ALT FNC" to escape
 cod. 05: Press "ALT CFM" to delete Lot00 or "ALT FNC" to escape
 cod. 06: Press "ALT CFM" to delete Lot 01-16 or "ALT FNC" to escape
 cod. 10: GLP
 cod. 11: Calibration alarm time-out
 cod. 20: Instrument ID Code
 cod. 30: Hour - Minute
 cod. 31: Day
 cod. 32: Month
 cod. 33: Year
 cod. 40: Auto OFF

cod. 41: Battery test
 cod. 50: Baud rate
 cod. 60: Release code
 cod. 70: Celsius or Fahrenheit
 cod. 99: Pass Code


Some of the most important functions are explained below in a step by step sequence.

TO SCAN LOGGED DATA (HI98810 and HI98840 only)

COD. 00 - Lot data Printing / Scrolling

- Select the code 00.
- The message "Lot data Printing" will scroll twice across LCD.

 - The upper LCD will then display L 00 with the 00 blinking.



- Set the desired lot by the arrow keys. L00 is the lot of data of the "log on demand" and L 01 to L 16 are the lots of the "timed log".
- Press the ALT and CFM keys to confirm the lot number.
- If the lot doesn't contain data, the "no data" message will scroll across the LCD twice and the meter will return to setup mode.
- If the lot contains one or more data the LCD will display the sample number in its upper part and Sn in the lower part.



Note: In the L 00 lot (log on demand) the sample number will be displayed with 3 digits (001).

- Select the sample number to scan by the arrow keys.

Printing logged data

- Press ALT and CFM to print logged data.
- If the selected sample number is invalid (equal to 0 or bigger than the number of samples), the "Err" message will be displayed for a few seconds.
- If the sample number is correct, the samples starting from the selected one to the last sample of the lot will be printed. To stop printing before the last sample is reached, press and hold the ALT and PAPER keys until the printer stops.
- During printout the LCD will display the sample number being printed at that moment. If printout is stopped the LCD will show the last printed sample number. It is then possible to select another sample.
- Press the ALT and FNC keys to return to setup mode.

Viewing logged data

- Press CH/TIME (HI98840 only) or TEMP/TIME (HI98810 only) to view data of the selected sample. Data will be displayed in the following order:
 - channel 1 temperature reading
 - channel 2 temperature reading (HI 98840 only)
 - channel 3 temperature reading (HI 98840 only)
 - channel 4 temperature reading (HI 98840 only)
 - date
 - time
- If CH/TIME or TEMP/TIME is pressed when the time is displayed, the LCD will pass to the next Sample number.
- It is then possible to scroll the data of the next sample by pressing CH/TIME or TEMP/TIME or select a different sample by the arrow keys.
- to return to setup mode, press ALT and FNC when the meter displays the sample number.

Cod. 02 - Lot summary printout

- Select the code 02.
- The message "Lot table Printing" will scroll twice across LCD.
- The meter will then print a complete set of information based on the data stored in memory:

- a - lot number
- b - logging interval
- c - starting date
- d - number of samples
- e - starting time
- f - logged channels numbers.

	#00	S.013		
a	#01	30 m	b	
		19/12/1998	c	
d	S.00007	15.40	e	
		1 2 3 4	f	
	#02	15 m		
		19/12/1998		
	S.00031	17.22		
		1 2 3 4		

Note For lot 00 the number of samples only will be printed.

DELETE LOGGED DATA (HI98810 and HI98840 only)

- Select code 05 to delete the Log on Demand data or code 06 to delete the Timed Log Data.
- A scrolling message will be displayed.
- Press the ALT and CFM keys to confirm deletion.
- It is also possible to escape without data deletion pressing the ALT and FNC keys.

TO RESET PRINTING SAMPLE NUMBER

(HI98710 and HI98740 only)

This feature resets the print on demand sample number to 001.

- Select the code 04
- A scrolling message will be displayed.
- Press the ALT and CFM keys to confirm reset or ALT and FNC to escape.

GLP DATA

Cod. 10 - viewing GLP data

- Select the code 10
- A message will scroll twice across LCD.
- The LCD will then display the instrument identification (ID) code.
- Press \uparrow to scan remaining data, in the following order:
 - channel 1 last calibration date (DD.MM)
 - channel 1 last calibration year
 - channel 2 last calibration date (DD.MM)
 - channel 2 last calibration year
 - channel 3 last calibration date (DD.MM)
 - channel 3 last calibration year
 - channel 4 last calibration date (DD.MM)
 - channel 4 last calibration year

Note: Data can be viewed in reverse order pressing the \downarrow key.

- Press ALT and FNC to return to function selection mode.


Code 20 - setting the identification (ID) code

When using several identical meters it may be useful to uniquely identify them by assigning an ID code to each meter.

- Select code 20. A message will scroll across LCD.
- Enter a 4-digit value using the arrow keys.
- Press ALT and CFM to confirm the value.

TESTING BATTERY LEVEL

 - Select code 41. The message "Battery test" will scroll across LCD.
- If the meter is connected to an external power adapter, the LCD will display "LINE" otherwise it will display bAtt on the upper display, and the remaining percentage of battery charge (100% means fully charged battery and 0% corresponds to the minimum battery voltage that allows the meter to operate).



TAKING TEMPERATURE MEASUREMENTS

To prepare the instrument for use, choose the most appropriate temperature probe(s) for your application (see accessories) and connect it (them) to the connector(s) located on the top of the instrument.

All the probes have been precalibrated at the factory and no calibration is needed.

With the meter facing you, channel #1 is the first connector on the top left hand side.

Press the ON/OFF key to power on the instrument.



To take temperature measurements, simply insert the probe in the sample to be tested and allow the reading to stabilize. The temperature is displayed on the upper LCD. The lower LCD displays the selected channel number (multi-channel versions only).



 
The meter selects channel 1 as default. Press CH/TIME (HI98740 and HI98840 only) or TEMP/TIME (HI98710, HI98810 only) to view the reading of the other channels, date and time in the following order:



- channel 2 temperature reading (HI98740, HI98840 only)
- channel 3 temperature reading (HI98740, HI98840 only)
- channel 4 temperature reading (HI98740, HI98840 only)
- date
- time


Pressing CH/TIME or TEMP/TIME again, the meter returns to channel 1 temperature reading.

If the reading is out of range or the probe is not connected to a channel, the LCD will display a dashed line in place of the reading.



Note: To choose between "°C" and "°F" unit, enter the setup code 70.

 Note: The meter is factory calibrated. After 1 year since last calibration the "DATE" symbol starts blinking on the LCD to







warn the user that a recalibration is suggested to maintain the greatest accuracy of the meter. It is recommended that recalibration is performed by authorized technical personnel only. Contact your nearest HANNA service center.

TEMPERATURE CALIBRATION PROCEDURE (for technical personnel only)


The meter is factory calibrated. It is recommended that recalibration is performed by authorized technical personnel only to assure the accuracy of the instrument. Contact your nearest HANNA service center for a quick and accurate annual recalibration.

A two-point calibration at -35.0°C (-31.0°F) and 120.0°C (248.0°F) has to be performed in order to store the new calibration data in memory.

    
1. Connect an HI762-35C calibration key to each channel of the meter.
2. Press ALT, CFM and PAPER simultaneously while the meter is not printing nor logging to enter calibration mode.
3. User is prompted to enter password if it has been set to a value different from 0000, otherwise skip to step 6.
4. Enter the password using the arrow keys.
5. Press ALT and CFM to confirm the password or CH/TIME or TEMP/TIME to exit.
6. If password is correct or not set, the meter will display "-35.0°C" on the upper LCD and "r1" on its lower part; if wrong, it will return to measurement mode without any message.
7. When the "S" symbol blinks in the lower LCD, the reading is stable and calibration can be confirmed.
8. Press ALT and CFM to confirm first calibration point.
9. The LCD will display CALC for a few seconds.
10. The second calibration point "120.0°C" will be displayed on the upper LCD and "r2" on its lower part.
11. Connect an HI762120C calibration key to each channel of the meter.
12. When the "S" symbol blinks in the lower LCD, the reading is stable and calibration can be confirmed pressing ALT and CFM.
13. "CALC" is displayed on the upper LCD for a few seconds and then the meter returns to normal operational mode.



 Note: If a wrong resistor value is connected to one or more channels, when confirming the calibration point the LCD will display "Err" and the first channel having a wrong input. Only the channels having a correct input will be calibrated.



 Note: If one or more channels are left open, when confirming the calibration point the LCD will display "----" and the first channel having an open input. Only the channels having a correct input will be calibrated.



Note: To escape before ending the calibration procedure press CH/TIME or TEMP/TIME.

HI 98810 - HI 98840 PRINTING / LOGGING FUNCTIONS

Two different modes to print / log data are available:


1. Timed logging; samples are stored and printed (if print function is active) at fixed time intervals. Data are stored in the lots 01 to 16.
2. Log on demand; samples are stored and printed (if print function is active) when the LOG key is pressed. Data are stored in the lot 00. It's possible to perform the Log on demand either in normal mode or in Timed logging mode.

It is possible to switch from logging without printing to logging with printing in two ways:

- set the function code 03 to "On" to enable printing, to "Off" to disable printing
- press ALT and PAPER to toggle between printer enabled and printer disabled while in Timed logging.


TIMED LOGGING MODE

To start Timed logging, press ALT and LOG. The lot number will be displayed for a few seconds then the LOG symbol will appear on LCD and if printer is enabled a first set of data will be printed. The "LOG" symbol will be fixed if printer is enabled and will blink if printer is disabled.

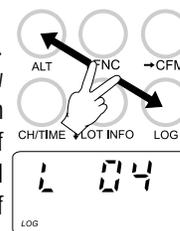

The printout provides the following information:

- a - Lot number
- b - Logging interval
- c - Date (only for the first printed sample of the lot or of the day)
- d - Sample number
- e - Time
- f - Readings ("----" means out of range).

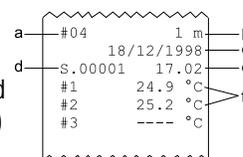


Note: channels with no probe connected are not logged nor printed.

If no keys are pressed, the meter enters standby mode to prolong the battery life and only the "LOG" indication will be visible on LCD. While logging, during the sleep mode, the last logged reading will appear briefly on the LCD. To reactivate the LCD press ON/OFF.

TO STOP LOGGING

In order to stop the recording mode, press ALT and LOG keys (press ON/OFF first, if meter is in sleep mode).

A last printout reporting the number of logged samples (e.g. S.00009) will be produced if printer is enabled.

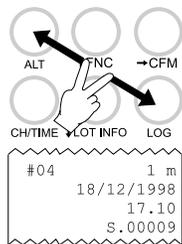


Notes:

- It is recommended to use the adapter during logging in printing mode, especially when many printouts are going to be taken.
- Before proceeding with logging with printing, make sure there is enough paper for your measurements. When the paper is finished the meter will not advise the operator and the printouts could be lost. If this happens, data will continue to be stored in memory, and it is always possible to print the data at a later time through setup code 00.
- It is possible to insert a new paper roll during logging session.
- Once in the logging mode, the interval cannot be changed. Exit the logging mode first (pressing the ALT and LOG keys) to set a new interval.
- If the LOG key is pressed while in logging with printing mode, a printout is produced without affecting the running sample number and the value is stored in Log on demand area.

LOW BATTERY CONDITION

Printout is automatically disabled when batteries charge weakens. The last message "Stop log" will be printed and data will continue to be stored in memory with the LOG and LOBAT symbols blinking on LCD. If the user attempts to enable the printer while in low battery condition the message "bAtt" will appear for a few seconds on the LCD.

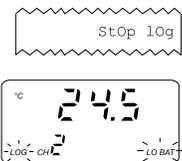

Note: When an external adapter or new batteries are connected, the printing must be manually enabled in order to return to logging with printing mode.

LOG ON DEMAND

In measuring or Timed log mode, press LOG to store the current reading. The LCD will display "Stor" and the value will be stored in the lot 00 (log on de-



mand data area). If the print function is enabled, a printout is also produced providing the following information:

- a - Date
- b - Sample number
- c - Time
- d - Readings ("----" means out of range or probe not connected)

	18/12/1998	a
b	S.002	17.25
c	#1	24.9 °C
d	#2	25.3 °C
	#3	---- °C
	#4	---- °C

Note: When the Log on demand data area is full and the LOG key is pressed, the sample will not be stored and the LCD will display "FULL". In this case it is necessary to delete the Log on demand data to proceed.

TO VIEW LOGGING INFORMATION

If the ALT and LOT INFO keys are pressed during logging, the meter displays for a few seconds the current lot and the number of logged samples. The meter then returns to normal operational mode automatically.



If ALT and LOT INFO are pressed while the meter is not logging, the last logged lot in the lower LCD and the number of logged samples in the upper LCD are displayed. It is then possible to scroll through the following lot information with the → key:

- lot starting date (dd.mm)
- lot starting year
- lot starting time (hh.mm)
- lot logging interval
- logged channels (HI 98840 only)

By pressing the → key again, the meter displays the number of logged samples again.

When the number of logged samples is displayed, it possible to pass to another lot with the ↑ and ↓ keys. Press ↓ to view the older lots or ↑ to view the more recent ones.

If ↑ is pressed when the last lot is displayed, the meter displays the lot 00 (log on demand). By pressing the ↑ key again, the meter will pass to the oldest lot.

Note For lot 00, only the number of samples will be displayed.

To exit from the logging info viewing mode press ALT and LOT INFO again or CH/TIME (HI98840 only) or TEMP/TIME (HI98810 only).

TO RETRIEVE LOGGED DATA

Logged data can be viewed on LCD or printed. To view or print logged data see "TO SCAN LOGGED DATA" in the "SETUP MODE" paragraph. The logging meters also allow the downloading of logged data to PC. To download data to PC see "DATA TRANSFER TO PC" paragraph.


HI 98710 - HI 98740 PRINTING FUNCTIONS

Two different modes to print data are available:

1. Timed printing; samples are printed at fixed time intervals. Data lots from 01 to 16 are available.
2. Print on demand; samples are printed when the LOG key is pressed. It's possible to perform the print on demand either in normal mode or in Timed printing mode.

TIMED PRINTING MODE

To start Timed printing, press ALT and LOG. The lot number will be displayed for a few seconds then the LOG symbol will appear on LCD and a first set of data will be printed. The printout provides the following information:

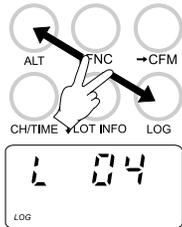

- a - Lot number
- b - Logging interval
- c - Date (only for the first printed sample of the lot or of the day)
- d - Sample number
- e - Time
- f - Readings ("----" means out of range).


a	#04	1 m	b
		18/12/1998	c
d	S.00001	17.02	e
	#1	24.9 °C	f
	#2	25.2 °C	
	#3	---- °C	

Note: channels with no probe connected are not printed.

If no keys are pressed, the meter enters standby mode to prolong the battery life and only the "LOG" indication will be visible on LCD. While timed printing during sleep mode, the last printed reading will appear briefly on the LCD. To reactivate the LCD press ON/OFF.

TO STOP PRINTING

In order to stop the recording mode, press ALT and LOG keys (press ON/OFF first, if meter is in sleep mode).

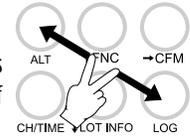

A last printout reporting the number of printed samples (e.g. S.00009) will be produced.


#04	1 m
	18/12/1998
	17.10
S.00009	

Notes:

- It is recommended to use the adapter during printing mode, especially when many printouts are going to be taken.
- Before proceeding with printing, make sure there is enough paper for your measurements. When the paper is finished the meter will not advise the operator and the printouts could be lost.
- It is possible to insert a new paper roll during printing session.
- Once in the timed printing mode, the interval cannot be changed. Exit the timed printing mode first (pressing the ALT and LOG keys) to set a new interval.
- If the LOG key is pressed while in timed printing mode, a printout is produced without affecting the running sample number.

LOW BATTERY CONDITION

Printing is automatically interrupted when batteries charge weakens. The last message "Stop log" will be printed and the LOBAT symbol will blink on LCD.

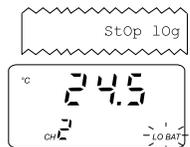

Note: When an external adapter or new batteries are connected, a new printing session must be manually restarted.

LOG ON DEMAND

In measuring or timed printing mode, press LOG to print the current readings. The printout provides the following information:



- a - Date
- b - Sample number
- c - Time
- d - Readings ("----" means out of range or probe not connected)

		18/12/1998	a
		17.25	c
b	S.002	24.9 °C	d
	#1	25.3 °C	
	#2	---- °C	
	#3	---- °C	
	#4	---- °C	

Note: If the user attempts to print while in low battery condition the message "bAtt" will appear for a few seconds on the LCD.

Note: It is possible to reset the sample number of the print on demand to 001 (see "TO RESET PRINTING SAMPLE NUMBER" in "SETUP MODE" paragraph).

GOOD LABORATORY PRACTICE (GLP)

GLP is a set of functions that allows the storage or retrieval (when necessary) of data regarding the maintenance and status of the meter.

LAST CALIBRATION DATE

Last calibration date is stored automatically after a successful calibration. The last calibration date can be displayed through setup code 10 (see "SETUP MODE" paragraph).

CALIBRATION ALARM TIME-OUT

The meter checks if the time-out time, fixed at 1 year, has expired every time it is turned on. It is possible to enable/disable this feature through setup code 11. The default value is "On".

If the time has expired, the message "Cal date" scrolls across the LCD. The "DATE" symbol will blink to remind to the user to perform a new calibration soon.



GLP AND RS232 (HI98810 and HI98840 only)

GLP data (ID code and last calibration date) can be retrieved from a PC through the RS232 communication feature (see "Data transfer to PC").

OTHER FEATURES

LCD BACKLIGHT

The LCD can be illuminated to allow the user to see the readings even in dark environments. This feature can be enabled/disabled pressing the ALT and LIGHT keys. If the LCD backlight feature is enabled, the LCD remains illuminated until the feature is disabled pressing the ALT and LIGHT keys. The LCD backlight can be disabled in order to save power and it is automatically disabled when battery charge weakens.

Note: When an external power supply is connected to the instrument, the backlight is not automatically enabled.

Note: When LOBAT appears on LCD it is not possible to enable backlight. If the user attempts to enable the LCD backlight in low battery condition, the meter will show "batt" on LCD.

Real Time Clock (RTC)

The instrument has an internal Real Time Clock (RTC) circuit with a backup lithium battery. This allows the meter to update time and date even when both batteries and external power adapter are disconnected.

 
DATA TRANSFER TO PC HI 98810 - HI 98840 only

HI98810 and HI98840 contain infrared transmitting circuitry.


Ensure there isn't any logging process active.

Press CH/TIME or TEMP/TIME to set the meter to time or date mode and simply place your data-logger on a HI9200 Infrared Transmitter (ensuring that the two infrared LEDs are placed on top of each other) and the memory content can then be downloaded to your PC through the HI9200's RS232 port. Just ensure that baud rate on instrument (setup code 50) and on PC downloading program are set to the same value.

During the data transfer the instrument displays the message "r 232".



To stop communication, press CH/TIME or TEMP/TIME to display the temperature reading or take the meter out of the transmitter when it's not displaying "r232".

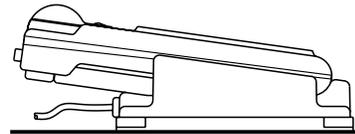

Using the HI9200 Infrared Transmitter, all recorded data can be fed to your Personal Computer for easy reproduction, storage or elaboration without the need of cables between the meter and the transmitter. Data transmission from the instrument to the PC is now much easier with new HI92000 Windows® compatible application software offered by Hanna Instruments.

HI92000 allows you to use the powerful capabilities of most spread sheet programs (e.g. Excel®, Lotus 1-2-3®). Simply open your file downloaded by HI92000 from your spread sheet program and then it is possible to make any elaboration available with your software (e.g. graphics, statistic analysis).

User friendly, HI92000 offers a variety of features and has an on line help to support you throughout any situation.

To install HI92000 you need a 3.5" drive and a few minutes to follow the instructions conveniently printed on the disk label.

Windows® is registered Trademark of "Microsoft Co."
Excel® Copyright "Microsoft Co."
Lotus 1-2-3® Copyright "Lotus Co."

MEMORY ORGANIZATION HI 98810 - HI 98840 only

Logged data are stored in the internal EEPROM and are retained even if batteries and external power are disconnected.

MEMORY CAPACITY

- 14000 data samples divided into 16 lots (lots 01 to 16)
- 9999 data samples maximum for a single channel
- 300 data samples for the Log on demand (lot 00).

TIMED LOG (lots 01 to 16)

Each time a new logging period starts, it automatically starts from the next available lot. If the last lot was the 16th, the new logging period restarts from lot 01 overwriting previously logged data.

When Timed logging memory is full, the meter overwrites the oldest lot data progressively reducing the old lots. In this case the starting time, date and the dimension of the old lot are updated.

Note: The oldest lot data are erased without any warning message.

Note: Timed logging memory can be entirely erased through the setup code 06.

If the meter is powered only by the external power supply and there is a temporary power black out during logging, when power returns, the logging continues normally if no samples have been lost, otherwise the current lot is ended and a new lot starts. If printer is enabled, the "...Stop..." message will be printed. In any case, during scrolling the former lot will be preceded by the "Interrupted Lot" message and the latter by "Continuation Lot" to indicate the interruption.

LOG ON DEMAND (Lot 00)

When Log on demand data area is full the meter shows the "FULL" message to warn the user that the data are not stored in memory. Erase the memory area through setup code 05 to continue logging data on demand.


PRINTER MAINTENANCE

TO CHANGE THE INK CARTRIDGE


When printouts become faint, it might be necessary to change the ink cartridge. Contact your Hanna authorized center.

TO INSERT THE PAPER ROLL


The meters use plain paper rolls 38 mm width. To insert a new roll open the paper cover pulling it gently and take the cylinder away.

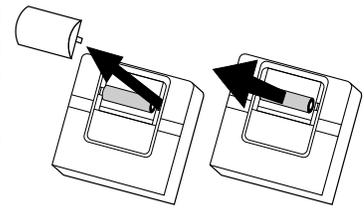

Insert the paper edge in the printer slot and feed the printer by pressing the PAPER key.

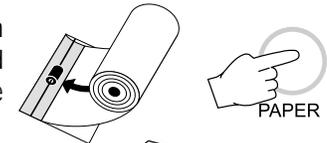

Allow about 5 cm (2") of paper to exit from the printer and replace the paper cover.

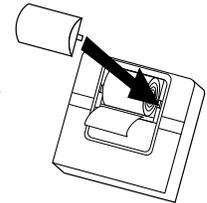

FAULT CONDITIONS

The printing/logging thermometers are factory programmed to automatically diagnose a fault and to display error codes on the LCD.

PRINTER ERROR

Whenever a printer fault condition is detected, the printer stops and the message "Printer error" scrolls across the upper LCD with the error code (see below) fixed on the secondary one.

- 1 = Motor locked
- 2 = Printer clutch jammed
- 3 = Selection lever fault

I²C BUS ERROR

 
In case of an I²C bus fatal error due for example to a defective EEPROM or RTC, the message "Serial bus error" keeps scrolling across LCD from right to left indefinitely. Meter should be returned for repair (see warranty section).

BATTERY REPLACEMENT

When the batteries are inserted and no power adapter is connected, the meter can recognize different batteries charge levels.

1. Fully charged batteries. The backlight and printer can be enabled.
2. Weakening batteries - "LOBAT" symbol blinks on LCD. The backlight and printer are automatically disabled and it is not possible to enable them until new batteries are inserted or an external power adapter is connected.
3. Weak batteries - "LOBAT" symbol stays still on lower LCD. Backlight and printer are disabled and meter can work for about 20 hours. If in Timed logging mode with the power down function enabled this time can be longer.
4. Dead batteries - LCD shuts off. The instrument stops working to avoid erroneous readings.


Note It is not possible to activate backlight and printer when the instrument is in a low battery condition. If the user attempts to enable these functions without replacing the batteries or connecting the external power adapter, the meter will show "batt" on LCD.



Battery replacement must only take place in a non hazardous area using 1.5V alkaline AA type batteries.

In order to replace run down batteries, simply remove the two screws on the rear cover of the instrument and replace the four 1.5V AA batteries with new ones, paying attention to the correct polarity.

A 12VDC power adapter can also be used to power the unit (see the accessories paragraph).

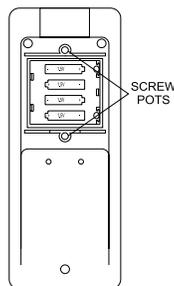

Note: The instrument uses the following configuration.



It is recommendable to purchase the Hanna HI710005 and HI710006 voltage adapters that use the proper polarity configuration.

However, the meters can be used with other adapters. In this case, remember to check the correct polarity of your adapter before connecting it to the meter.

TEST PLUGS

All Hanna Instruments thermometers have been accurately pre-calibrated at the factory. However, as a general rule, it is recommended to have all thermometers recalibrated at least once a year.

For an accurate annual recalibration, contact your nearest Hanna Service Center.

Hanna Test Plugs provide a quick and easy way to test the meter's accuracy by simply connecting them to the probe connector of the meter.



If the reading differs by more than 0.4°C (0.8°F) from the Test Plug value, the unit is due for re-calibration.

Choose the right Test Plug to suit your needs:


HI762-35C	Calibration key,	-35.0°C	±0.4°C
HI 762-18C	Calibration key,	-18.0°C	±0.4°C
HI 762000C	Calibration key,	0.0°C	±0.4°C
HI 762070C	Calibration key,	+ 70.0°C	±0.4°C
HI 762120C	Calibration key,	+ 120.0°C	±0.4°C
HI 762-31F	Calibration key,	-31.0°F	±0.8°F
HI 762-004F	Calibration key,	-0.4°F	±0.8°F
HI 762032F	Calibration key,	+ 32.0°F	±0.8°F
HI 762158F	Calibration key,	+ 158.0°F	±0.8°F
HI 762248F	Calibration key,	+ 248.0°F	±0.8°F

TEMPERATURE PROBES

Hanna Instruments offers a wide range of probes to meet all your requirements (from liquids to air and penetration to surface). These probes use highly sensitive thermistor sensors which provide greater accuracy, faster response and a temperature range that is superior to conventional thermistor probes. All Hanna temperature probes are supplied pre-calibrated from the factory and are ready to be used with your meter. The probes are easy to connect to your meter with a standard RCA connector. Completely interchangeable, these probes make it possible for you to switch from one to another without wasting time going through tedious calibration procedures. They are available in different handle colors to avoid cross contamination during testing:

- HI 762A Air probe, 1 m (3.3') cable and white handle
- HI 762A/10 Air probe, 10 m (33') cable and white handle

- HI 762BL General purpose liquid probe, 1 m (3.3') cable, black handle
- HI 762L General purpose liquid probe, 1 m (3.3') cable, white handle
- HI 762L/2 General purpose liquid probe, 2 m (6.6') cable, white handle
- HI 762L/10 General purpose liquid probe, 10 m (33') cable, white handle
- HI 762PBL Penetration probe, 1 m (3.3') cable, blue handle
- HI 762PBL/10 Penetration probe, 10 m (33') cable, blue handle
- HI 762PG Penetration probe with 1 m (3.3') cable, green handle
- HI 762PG/10 Penetration probe, 10 m (33') cable, green handle
- HI 762PR Penetration probe, 1 m (3.3') cable, red handle
- HI 762PR/10 Penetration probe, 10 m (33') cable, red handle
- HI 762PW Penetration probe, 1 m (3.3') cable, white handle
- HI 762PW/10 Penetration probe, 10 m (33') cable, white handle
- HI 762W Wire probe, 1 m cable without handle (hard-to-reach places)
- HI 762W/10 Wire probe, 10 m cable without handle (hard-to-reach places)

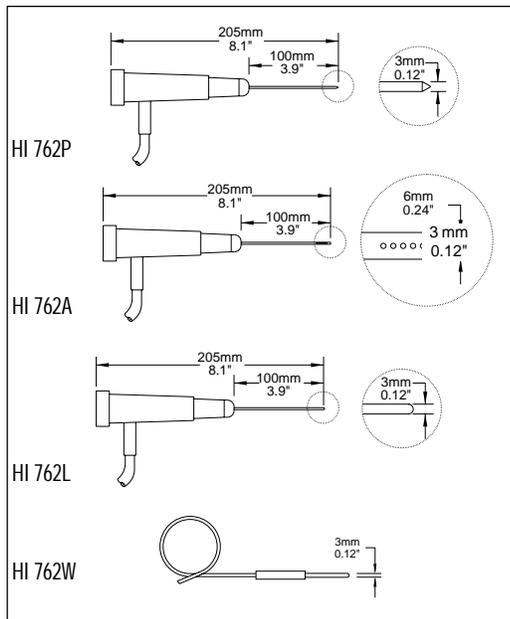


UN-HOUSED NTC SENSORS


It is often necessary in the laboratory to "customize" testing to meet specific criteria. For this reason, Hanna offers a wide line of NTC Thermistor sensors that can be custom mounted in almost any situation. Select the sensor that matches your application, attach it to the RCA adaptor and plug it into the meter. You now have a temperature sensor that is custom fit to your requirements.

The following is a list of the NTC Thermistor sensors and plug available:

 
HI 76P2-1 RCA plug with 1 meter (3.3') cord.




HI 76S2-1 NTC Thermistor sensor. Teflon[®] coated with hole for mounting.

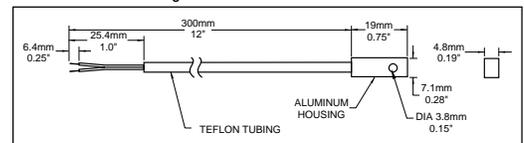


HI 76S2-2 NTC Thermistor sensor. Self-adhesive, foam disk for mounting.

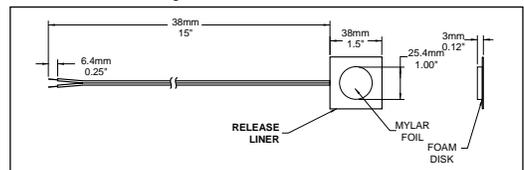

HI 76S2-3 NTC Thermistor sensor. Eye-connector for mounting.

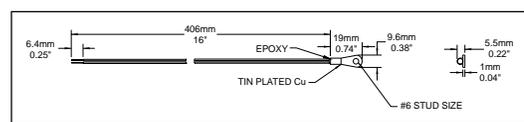


HI 76S2-4 NTC Thermistor sensor. Molded tip with epoxy seal for aggressive environments.

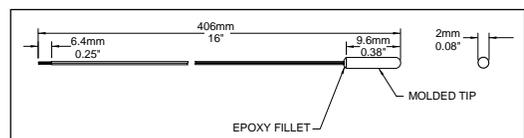


Teflon[®] is registered Trademark of "du Pont de Nemours & Co."


HI 76S2-5 NTC Thermistor sensor. Aluminum tab with mounting hole.

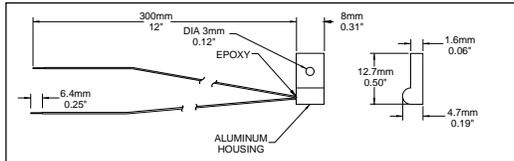

HI 76S2-6 NTC Thermistor sensor. PVC encapsulated tip for protection in aggressive environments.

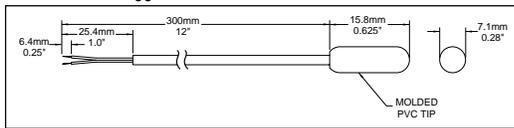


HI 76S2-7 NTC Thermistor sensor. Can be housed and used in any custom application.

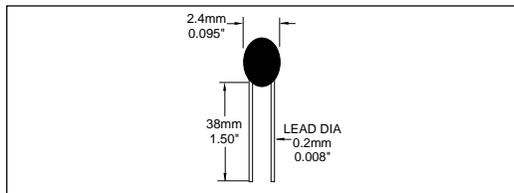

ACCESSORIES

HI710005 Voltage adapter from 115 VAC to 12 VDC

HI710006 Voltage adapter from 230 VAC to 12 VDC

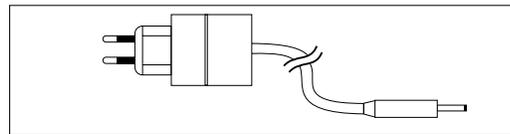

HI 710031 Rugged carrying case

HI 710034 Plain Paper Spare Rolls (10 pcs)

HI 710035 Spare Ink Cartridge (1 pc)

HI 740027 1.5V AA batteries (4 pcs)

HI 9200 Infrared Transmitter (HI98810, HI98840 only)

HI 92000 Windows® compatible software for data transfer to PC (HI98810, HI98840 only)

Windows® is registered Trademark of "Microsoft Co."

WARRANTY

All Hanna Instruments meters are warranted for two years against defects in workmanship and materials when used for their intended purpose and maintained according to instructions. The electrodes and the probes are warranted for a period of six months. This warranty is limited to repair or replacement free of charge.

Damages due to accident, misuse, tampering or lack of prescribed maintenance are not covered.

If service is required, contact the dealer from whom you purchased the instrument. If under warranty, report the model number, date of purchase, serial number and the nature of the failure. If the repair is not covered by the warranty, you will be notified of the charges incurred. If the instrument is to be returned to Hanna Instruments, first obtain a Returned Goods Authorization number from the Customer Service department and then send it with shipping costs prepaid. When shipping any instrument, make sure it is properly packaged for complete protection.

To validate your warranty, fill out and return the enclosed warranty card within 14 days from the date of purchase.

Hanna Instruments reserves the right to modify the design, construction and appearance of its products without advance notice.

CE DECLARATION OF CONFORMITY

Recommendations for Users

Before using these products, make sure that they are entirely suitable for the environment in which they are used.

Operation of these instruments in residential area could cause unacceptable interferences to radio and TV equipments, requiring the operator to take all necessary steps to correct interferences.

Any variation introduced by the user to the supplied equipment may degrade the instrument's EMC performance.

To avoid electrical shock, do not use these instruments when voltages at the measurement surface exceed 24VAC or 60 VDC.

To avoid damages or burns, do not perform any measurement in microwave ovens.

HANNA
Instruments

CE

DECLARATION OF CONFORMITY

We, Hanna Instruments Italia Srl
via E.Fermi, 10
35030 Sarmeola di Rubano - PD
ITALY

herewith certify that the printing/logging thermometers:

HI 98710 HI 98740 HI 98810 HI 98840

have been tested and found to be in compliance with the following regulations:

IEC 801-2 Electrostatic Discharge
IEC 801-3 RF Radiated
IEC 801-4 Fast Transient
EN 55022 Radiated, Class B
EN 61010-1 User Safety Requirement


Date of Issue: 10-12-1998

D. Volpato - Engineering Manager
On behalf of
Hanna Instruments S.r.l.


HANNA LITERATURE



LAB RECORDING

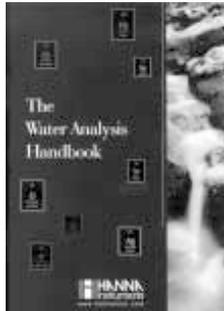

WATER ANALYSIS HANDBOOK

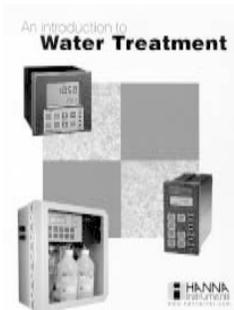

WATER TREATMENT



GENERAL CATALOG

PRINTED IN PORTUGAL

MAN98840R1
2/99

These and many others catalogs, handbooks and leaflets are available from Hanna. To receive your free copy, contact your dealer or the nearest Hanna Customer Service Center.



<http://www.hannainst.com>